

MB1K Series 032, 040, 050 063, 080, 0100



Construction

The production of this series has been discontinued. Check the following before ordering. • New series MB1K-Z ⇒ p. 54 • Checking whether the cylinder is a new or a previous model → p. 769, 770

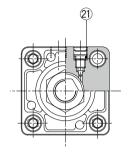

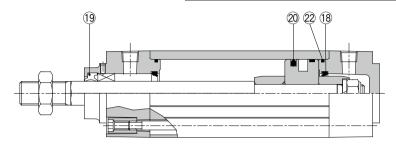

- * The numbers correspond with those in the "Construction" of the MB1K series in the Web Catalog.
- * Replaceable with the rod boot assembly
- For details on replacement part numbers, refer to page 245.

Seal Kit List

No.	Description	Material	Note	
18	Cushion seal	Urethane		
19	Rod seal	NBR	21 is a non-replaceable	
20	Piston seal	NBR	part, so it is not included	
21	Cushion valve seal	NBR	in the seal kit.	
(22)	Cylinder tube gasket	NBR		

Replacement Parts: Seal Kit

Bore size (mm)	Part no.	Contents				
32	MBK32Z-PS					
40	MB1K40Z-PS					
50	MB1K50Z-PS	Set of nos.				
63	MB1K63Z-PS	18, 19, 20, 22				
80	MB1K80Z-PS					
100	MB1K100Z-PS					

- * The seal kit includes ® to ②, ②. Order the seal kit based on each bore
- * The seal kit includes a grease pack (ø32 to ø50 : 10 g, ø63, ø80 : 20 g, ø100 : 30 g).

Order with one of the following part numbers when only the grease pack is required.

Grease pack part no.: GR-S-010 (10 g), GR-S-020 (20 g)

* Model without air cushion is designed to include rubber bumpers.